

Firmware Change History for TM-m50

Version	Category	Detail
01.08 ESC/POS	Function change	Supported OT-WL06 in some regions (CIS, MEA)
	Bug fix	Fixed a bug that unable to connect to WPA2 Enterprise APs using RADIUS servers that do not support TLS 1.0.
		Fixed a bug that the page mode area and the line spacing are changed when specifying "mul" as the lang attribute to the text tag on ePOS-Print.
		Fixed a bug that the cloud information cannot be got via WebConfig API.
01.09 ESC/POS	Bug fix	Fixed a bug that the firmware version of the sub-microcomputer may not be obtained.
01.10 ESC/POS	Bug fix	Fixed a bug that, if the cover is opened during the cutting operation, the cover may not be closed.
01.11 ESC/POS	Function change	Changed the power supply spec for Device Charging Port.
01.12 ESC/POS	Function change	Improved a connectivity to AP (SSID is in the stealth mode) with W53/W56 when using OT-WL06.
01.15 ESC/POS	Function change	Modified the firmware so that the alternative part operates correctly on the printer to deal with EOL of the current USB HUB.
	Bug fix	Fixed a bug that a character string following the 2-byte character (printed as '?') to the end of ` <code>&lt;text&gt;</code> ` tag cannot be printed with the ePOS-Print.